

Vogue®


PROFESSIONAL

Instructions for Twist-Lock Handpiece General Instructions for Rotation Speed (all drills)

Mounting and removing bur

Originally ϕ 2.35mm blank bar is attached but any bit can be mounted as you like. Please mount the collet suitable for the chosen bit.


1. Holding Handpiece in hand, turn Set Ring fully toward "R" direction. Taking out blank bar, put your bit into the bottom of collet.
2. Return the Set Ring to "S" direction, where collet is secured.
3. Make it sure with fingers that your bit and collet can rotate. When ensuring it, please take care of bit edge not to hurt your finger.

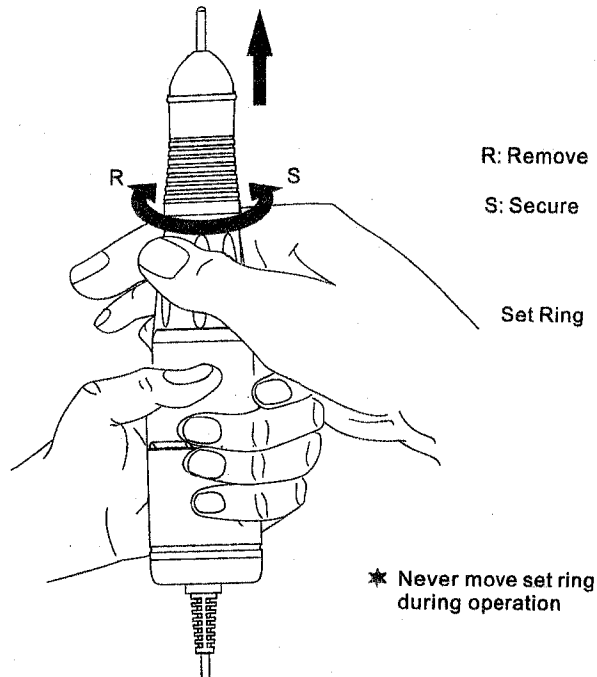

Precautions when using the micromotor

1. Wear safety goggles or a safety shield to protect your eyes or face when cutting or grinding works.
2. Never use bent, asymmetrical or damaged burs.
Always use standard burs.
3. The sudden start is dangerous at high rotation speed.
Accelerate slowly from low speed to desired speed.
4. Take every possible care not to drop the motor.
(It may damage ball bearing or weaken durability of the motor)
5. Always keep the allowable rotation speed according to type of bur for your safety even though the motor is fully within the speed range max. 5,000 rpm.
6. Never try to operate the chuck handle while the motor is in operation.
7. Clean the motor after using.

Allowable rotation speed

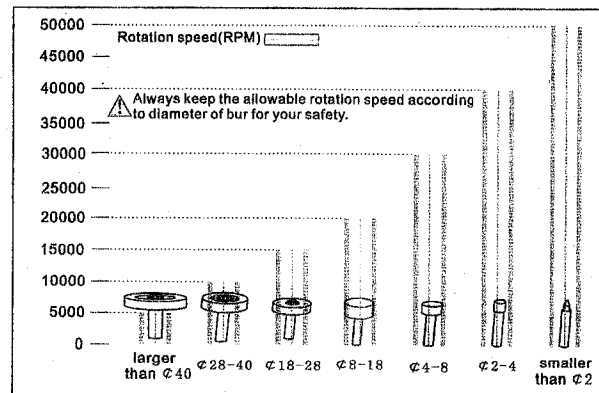

This chart for allowable rotation speed can be slight different depending on our materials or types